


Quick connector, 8/10 mm slot, 0°





- For the right-angled connecting of two profiles
 - Very good accessibility for tools during assembly
 - O-ring for fastening allows overhead assembly
 - Quick connectors can be swiveled into the profile slot at the point of assembly
 - Profile finishing: blind hole DI, DB11, DB17 or through-hole DI, D11, D17
-
- Note differing drilling intervals and load-bearing capacities when using with radial compensation
 - Quick connector 9.8 with smaller connector sleeve
 - The hole for the connector sleeve does not make contact with the slot flanks. This allows a visually attractive connection; the slot can be completely closed with the cover profile

Product description

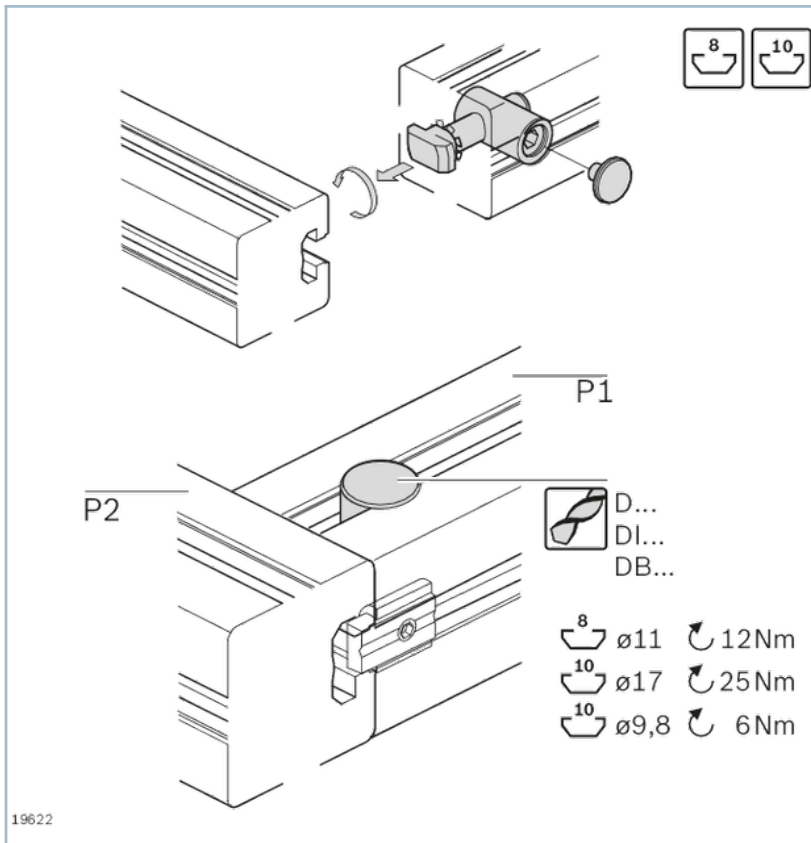


Connection elements, selection criteria

Technical data

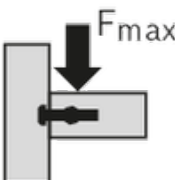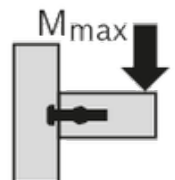
Nut				
8/8	500 N		40 Nm	
8/10	2000 N		70 Nm	
10/10	4000 N		140 Nm	
10/10	800 N		50 Nm	

Dimensions

Quick connector, 8/10 mm slot, 0°

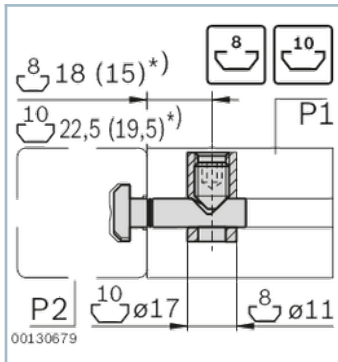

Quick connector, 10/10 mm slot, 0°, connector sleeve D = 9.8

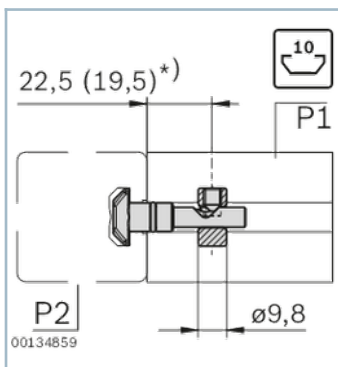

Accessories


Recommended accessories

Anti-torsion element

Radial compensation

Drilling jig

Cap

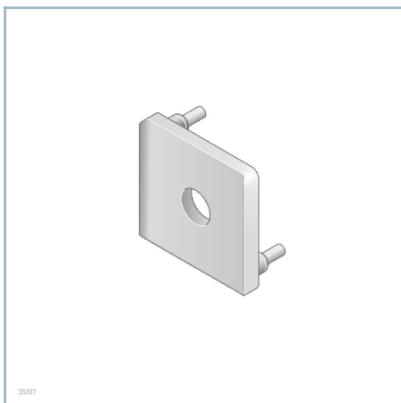

Radial compensation

- To avoid gaps and sharp edges on T-connections between two profiles using a central bolt or quick connector (note spacing of hole from the face of the profile)
- The slot segments can be broken out in order to fix surface elements in the slot

- Important note: the load carrying capacity of the profile connection is reduced when using radial compensation!



Anti-torsion element

- Provides torsion resistance for profile connections with central bolts or quick connectors
- Subsequent installation in the connection possible



Quick connector, 6 mm slot,
0°, 90° cover cap

- For the right-angled connecting of two profiles
- Very good accessibility for tools during assembly
- Quick connector for 6 mm slot with square head; can be used as a 0° or 90° connector
- Profile finishing: Blind hole DB8 or through-hole D8

Ordering codes

	Groove	P1 / P2	D		ESD	No.
			mm			
Quick connector 0° steel, galvanized N8	8	8 / 8	11	10		3842535459
Quick connector 0° steel, galvanized N8/10	8; 10	8 / 10	11	10		3842535464
Quick connector 0° steel, galvanized N10	10	10 / 10	17	10		3842535458
Quick connector 0° steel, stainless N8	8	8 / 8	11	10		3842548934
Quick connector 0° steel, stainless N8/10	8; 10	8 / 10	11	10		3842548935

	Groove	P1 / P2	D		ESD	No.
			mm			
Quick connector 0° steel, stainless N10	10	10 / 10	17	10		3842548936
Quick connector 0°, connector sleeve D = 9.8	10	10 / 10	9.8	10		3842541412
Cover cap, quick connector D11			11	100		3842538563
Cap, quick connector D17			17	100		3842538564